



भारत सरकार

खान मंत्रालय

भारतीय खान ब्यूरो, क्षेत्रीय कार्यालय रायपुर  
दूसरी मंजील, जीएसआई फील्ड प्रशिक्षण केन्द्र

महालेखाकार आफिस कोम्प्लेक्स, पोस्ट-विधान सभा- रायपुर- (छ.ग)-492005

फोन- 0771--2282530/2285590/95 [मेल- ro.raipur.ibm@gmail.com](mailto:ro.raipur.ibm@gmail.com)

No- CHG/RNG/FE-1/NGP

दिनांक -20/04/2020

प्रेषिति- श्री नीरज ठाकुर, एजेंट खानए  
डोंगरबोर लौह आयस्क खान  
M/S सारदा एनर्जि एवं मिनेरल्स लिमिटेड  
इंडस्ट्रियल ग्रोथ सेंटरएफेस-1ए  
सिलताराएरायपुर(छ.ग.)-493111

विषय- छत्तीसगढ़ राज्य के राजनन्दगाँव जिले में स्थित आपकी डोंगरबोर लौह आयस्क खान (Area 80.71Ha.)  
में खनिज संरक्षण एवं विकास नियमावली 2017 के नियमों के उलंघन के संबंध में-

महोदय

The following provisions of Mineral Conservation and Development Rules, 2017 were found violated during inspection of the above mine on 17.03.2020 by undersigned accompanied by Shri Neeraj Thakur, Agent(Mine).

Rule	Nature of Violation observed
11(1)	Mining operations should have been undertaken in accordance with the approved Review of Mining Plan. The Review of Mining Plan was approved vide letter no. राजनंद/ लौह /खयो-1126/2015-रायपुर dated 14.12.2017 and following deviation was observed during inspection 1. The mining operation is proposed in 2 pits in ore body IV with one bench and Ore body I with four benches upto 680 RL but working is only carried out in Ore body 1 with 8 benches upto RL 665. 2. The bench width is proposed more than bench height and minimum 5 meters but working is not done as per proposal and width is maintained less than height of benches. 3. The OB dump is not as per proposal and dumping of ROM, BHQ, Waste and slime all are dumped in same places. The waste dump is proposed upto Top RL of 478 but actually the top RL is more than 490 with proper terracing. The slime is stored in between the dump.
37(1)	The existing protective measures taken around waste dump are insufficient and it has been found that the waste material was escaping and washing away from the dumps and was contaminating the nearby area and extending outside lease boundary and no retaining wall constructed neither proper terracing done. A proper protective measure should be taken to prevent the escape of the material from the existing waste dumps.
45(5)(c)(i)	While scrutiny of Annual returns 2018-19 following deviation observed: i. The cost of production is mentioned as Rs 1337/- whereas the ex-mine price is Rs 795 to 962 of various grade. ii. In approved review of mining plan the area for plant and infrastructure is mentioned as 2.5 ha. whereas as per annual return it is mentioned 7.50 ha.. iii. As per approved document reclaimed/rehabilitated area is nil whereas 2.656 ha. is mentioned in return.

2 इस संदर्भ में आपका ध्यान आकर्षित किया जाता है कि उपरोक्त नियमों का उल्लंघन खनिज संरक्षण एवं विकास नियमावली 2017 के नियम 62 के अंतर्गत दंडनीय अपराध है। एवम इस नियम का उल्लंघन की अनुपालना नहीं होने पर खनिज संरक्षण एवं विकास नियमावली 2017 के नियम 11(2) एवम 45(7)(क) के अंतर्गत (क) खान की सारी खनन संक्रियाएँ बंद की जा सकती हैं।

(ख) आपके विरुध अभियोग दायर किया जा सकता है 1

(ग)खनन पट्टे को निरस्त करने की सिफारिस राज्य सरकार से की जा सकती है।

3 अतः आपको सलाह दी जाती है कि आप उपरोक्त उल्लंघनो का अतिशिघ्र सुधार करे एवम इसके सुधार की सूचना इस पत्र के जारी होने से 45 दिन के भितर इस कार्यालय को सूचित करे।

भवदीय

(राजेश कुमार दास)

वरिष्ठ सहायक खान नियंत्रक  
भारतीय खान ब्यूरो, रायपुर

प्रतिलिपि – for information please

- 1 खान नियंत्रक(मध्य), भारतीय खान ब्यूरो , नागपुर
- 2 संचालक, भौमिकी एवं खनिकर्म, छत्तीसगढ, इंद्रावती भवन, द्वितीय तल, डी ब्लॉक, केपिटल कॉम्प्लेक्स, नया रायपुर, छत्तीसगढ

वरिष्ठ सहायक खान नियंत्रक  
भारतीय खान ब्यूरो, रायपुर