


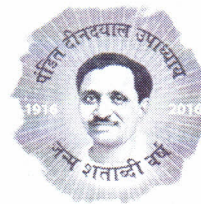

भारत सरकार GOVERNMENT OF INDIA  
खान मंत्रालय MINISTRY OF MINES  
भारतीय खान ब्यूरो INDIAN BUREAU OF MINES  
क्षेत्रीय खान नियंत्रक के कार्यालय  
OFFICE OF THE REGIONAL CONTROLLER OF MINES



BY EMAIL

Phone: 0674-2352463

TeleFax: 0674-2352490

E-mail:

ro.bhubaneshwar@ibm.gov.in

Plot No.149, Pokhariput

BHUBANESWAR-751020

No. ORI/IRON/SNG/MCDR-7/BBS (VOL-II)

Date: 25.07.2017

To

✓ Shri Y. Nagendra, Mines Agent,  
T.R.B. Iron Ore Mine,  
M/s Jindal Steel & Power Limited.  
At/Po Tensa, Dist. Sundargarh,  
PIN-770042 (Odisha)

Sub: Violation of provisions of Mineral Conservation & Development Rules, 2017 in respect of your T.R.B. Iron Ore Mine, over an extent of 207.787 hectare in Sundargarh District.

Sir,

 
The following provisions of MCDR, 2017 were found violated in your above mine during inspection on **08/07/2017** by undersigned along with Shri. S.R.Mazumdar (Senior Mining Geologist) in presence of Shri. M.C.Hembram, Senior Inspector of Mines, O/o Dy. Director of Mines, Koira Circle, Shri Y. Nagendra, Mines Agent, Shri Panchanan Singh, Mines Manager & Shri R.K.Chaturvedi, Geologist.

Mining Operation have not been carried out in accordance with the Scheme of Mining (SOM) approved vide Letter No. MS/FM/37-ORI/BHU/2014-15 dated 27.03.2015 to the extent indicated below.

Rule No.	Proposal	Nature of Violation
11(1)	(1). The topographical slope control can affect washouts of minerals and dumps on heavy rains. As a mitigation measures, the solid waste to be stacked over the ground with appropriate slope management.	(1) During inspection it is observed that Terracing of the OB dump from 745 mRL to 760 mRL located between coordinates 776N to 800N & 1025E to 1050E has been rain cut and not maintained properly.
	(2). Construction of Check Dam-One (01) Number in the year 2016-17	(2) Check Dam No-2 has been constructed in the year 2016-17 but not maintained properly.
	(3). Height and Width of the Bench in patch-1 Quarry as per the development plan 2017-18 should be 9m and 12 m respectively.	(3) During inspection it is observed that the Bench width and height have not been maintained in Patch 1 quarry between coordinates 1700 E to 1800E & 500N to 600N.

	(4). No. of boreholes (Core/RC/DTH) planned to be drilled in year 2016-17 was 12 Nos.	(4) In 2016-17, only 09 nos. of bore holes have been drilled.
54 (C)	(5) The holder of a mining lease or a holder of a prospecting licence or prospecting license cum mining lease shall maintain the labour attendance register, production and dispatch register, royalty assessment register,— (c) details of expenditure incurred towards the mine closure activities, explosives consumption register, bore hole logs along with the chemical analysis reports, mineral analysis reports, sub-grade or mineral reject stack register along with the grade;	(5) The subgrade or mineral reject stack register along with grade is not maintained properly and not made available during inspection.

- 02 In this connection, it is brought to your notice that the above violations constitute an offence punishable under rule 62 of Mineral Conservation and Development Rules, 2017.
03. The mining operations can be suspended under rule 11(2), if compliance of rule 11(1) is not found satisfactory.
04. You are advised to rectify the above violations immediately and intimate the position to this office within 45 (forty-five) days from the date of issue of this letter.

  
26/07/17

(HARKESH MEENA)  
Regional Controller of Mines  
Indian Bureau of Mines

Copy forwarded to:

1. The Controller of Mines (EZ) / Indian Bureau of Mines / Kolkata.
2. The Director of Mines / Directorate of Mines / Government of Orissa / Heads of Department Building / New Capital / Bhubaneswar-751 001.

  
(HARKESH MEENA)  
Regional Controller of Mines  
Indian Bureau of Mines