Hkkjr ljdkj [kku e≢ky; Hkkjrh; [kku C;jjks {k⊊h; [kku fu;æd dk dk;k∛y;



Government of India
Ministry of Mines
Indian Bureau of Mines
Office of the Regional Controller of Mines.
Ph-(0674)2742463 / Fax-0674 2744430

File No. ORI/IRON-BXT/SNG/MCDR-2 /BBS	Mahani Complex, 2 nd Floor, 308, District Centre, Chandrasekharpur, Bhubaneswar-751 016
To.	Date: 29.05.2015

To, Sri. M.D.Rustagi, Nominated owner & Director,

M/s Rungta Sons (P) Ltd., Rungta Office,

Main Road, Barbil,

Dist: Keonjhar (Odisha), PIN- 758 035

Sub: Violation of provisions of MCDR' 1988 in respect of Sanindpur Iron & Bauxite Mine (over 147.10 Hect.), of M/s Rungta Sons (P) Ltd., in Sundergarh-district of Odisha State. Sir.

The following provisions of Mineral Conservation and Development Rules,1988 were found violated in your above said mine during inspection on 17.04.2015 by the undersigned, accompanied by Sri S.K.Garnaik, Mines Manager of your mine.

Rule No.	Nature of Violation
13(1)	Mining operations have not been carried out in accordance with the Scheme of Mining approved, dated 26.02.2015 to the extent indicated below: Height of active waste Dump-B (exist in west side of quarry), was found more than approved. In Para 7.3, read with plate no5A, of Scheme of Mining, height of this Waste Dump-B is approved up to Top RL 645 m at the S-E side to the end of year 2015-16. Whereas, it was observed during inspection that the height of this waste dump has already been reached up to Top RL 663 m in this side. Also, regular terracing of this dump at average 10 mtr. intervals was not carried out as approved. Further, rain cuts observed developed in the dump slopes at places, which were not found checked by constructing nos. of small check dams as approved. These have endangered the systematic and scientific mining as well as protection of environment.
27(3)	Surface plan up dated as on 24.03.2015 and kept/maintained in the mines office was not found accurate with actual field position in respect of waste dumps profile and also, many sub-grade & fines stacks, ROM ore stacks, lease area proposed to be surrendered/retained, forest/non-forest area etc. were not shown over the same.

02. In this connection, it is brought to your notice that the above violations constitute an offence punishable under Rule 58 of MCDR, 1988.

Besides, inability to comply with the provision of Rule 13 (1) is also liable for suspension of mining operations under the provisions of rule 13 (2) of MCDR, 1988.

O3. You are advised to rectify the above violations immediately and intimate the position to this office within **45** (forty-five) days from the date of issue of this letter.

Yours faithfully,

eny ifr ij ugh / Not on Original ifrfyfi fuEu dks l knj l npukFkl vxf"kr

- (1) [kku fu; ≱d(e/; kpy)/The Controller of Mines (CZ), Hkkjrh; [kku C; jjk@Indian Bureau of Mines, ukxijj/Nagpur-440 001.
- (2) Mk; jDVj vMD ekbUl /The Director of Mines,Mk; jDVkjV vMD ekbUl @Directorate of Mines,mMH k ljdkj /Government of Orissa, gMl vMD fMikVeV fcfYMx /Heads of Department Building, U; w d&i Vy /New Capital, Hkpusoj /Bhubaneswar-751 001.

(PREM PRAKASH)

Sr. Assistant Controller of Mines

drs {k∈h; [kku fu; ⊭d/For Regional Controller of Mines