

GOVERNMENT OF INDIA
MINISTRY OF MINES
INDIAN BUREAU OF MINES
Office of the Regional Controller of Mines, Hyderabad

No. AP/NLG/Lst-3/HYD

Room No.603, 6th Floor,
CGO Towers, Kavadiguda,
Secunderabad.-500080.

Date:

10 MAR 2022

To

Shri K Gautham, Nomnated Owner and Executive Director
Mattampally Limestone Mine
M/s NCL Industries Limited
Plot No.140, NCL Enclave
Petbashirabad, Hyderabad-500055

Sub: Violation of provisions of Mineral Conservation and Development Rules, 2017 in respect of Mattampally Limestone Mine of M/s NCL Industries Limited over an extent of 46.356 ha situated in Sy. No.88 compartment No.4 n Mattampally Village, Huzurnagar Range, Mattampalli Village and Mandal, Suryapeta District of Telangana State.

Sir,

The following provisions of Mineral Conservation and Development Rules, 2017 (MCDR, 2017) were found violated in your above mine during inspection of the mine on 20.01.2022 by the undersigned accompanied by Sri Mahipal Reddy, Mining Engineer.


Rule No.	Nature of Violation
11(1)	<p><i>No holder of a mining lease shall commence or carry out mining operations in any area except in accordance with the mining plan approved, modified or reviewed by the Indian Bureau of Mines or prepared and certified in accordance with the system established by the State Government pursuant to the proviso to clause (b) of sub-section (2) of section 5</i></p> <p>Mining operations are not being carried out in accordance with the proposals given in approved Review of Mining Plan vide letter no. AP/NLG/MP/LsT-31/Hyd dated 08.04.2021 to the extent indicated below:</p> <ol style="list-style-type: none"> Mining operations are approved to carry out beyond Pulichintala Dam HFL line and in between grid lines S-832 to S629 and W 42-E 172, S780-to S682, E16 to E460, S745to S642 and E 6 to E 413, S 670 to S204 and E21 to E255, S635 to S37 and E 418 to E476 and ,S524 to S-224 and E88 to E339 for the year 2020-21. <p>Whereas during inspection of mine it was observed that mining operations are being carried out within HFL line of Pulichintala Dam and beyond approved proposals of the plan period as well.</p> <p>Thus, the area put to use for mining and allied activities is about 40.0 Ha which is more than the area i.e. 38.47 Ha considered for Financial assurance.</p> <ol style="list-style-type: none"> Mining operations are proposed to be carried out by maintaining bench height of 7 meters; against which bench height of about 8 meters is observed.
31(4)	<p><i>The plans and sections required under these rules shall be maintained up to date within three months in case of category 'A' mines as referred to in clause (a) of sub-rule (2) of rule 55, and within twelve months in the case of any other mine.</i></p> <p>Plans and sections have not been found maintained updated as required under the provision of this rule.</p>

45 (5) (7)	<p>Discrepancies are observed in the Annual returns submitted for the year 2020-21 which are as below:</p> <ol style="list-style-type: none"> i. Part-I: Item 2 Location of Mine; following details are to be furnished/ rectified Name of District, State. ii. Part-I: Item 3: Name and address of owner to be furnished correctly: Post office, Tahsil and District are not submitted. Further State is furnished as Andhra Pradesh instead of Telangana. iii. Part-I: item 11: Date of execution of Mining Lease deed and date of renewal of lease is furnished as 20.02.2018 and 13.10.2030 instead of initial date of execution of lease 06.06.1980 and renewal of lease on 20.02.2018. iv. Part-I: item 12: Area under current working is more than area furnished i.e. 35.13 Ha. v. Part-II: Item 1, Value of fixed asset of Rs. 4799661 is cumulative figure not account for single lease, therefore details of all the leases shall be furnished
---------------	--

02. In this connection, it is brought to your notice that the above violation constitutes an offence punishable under Rule-62 of MCDR, 2017. Besides, inability to comply the provisions of rule 11(1) and 45 (5)(7) of MCDR, 2017 is also liable for suspension of mining operations under rule 11(2) and 45 (5)(7)aa¼a½ ¼i½ of MCDR, 2017

03. You are advised to rectify the above violations immediately and intimate the position to this office within 45 (Forty Five) days from the date of issue of this letter.


Yours faithfully,

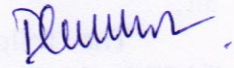

इब्राहिम शरीफ (IBRAHIM SHARIEF)
उप खान नियंत्रक/ Deputy Controller of Mines

Copy for information & further necessary action to:


- (1) The Director General of Mines Safety, Zonal Office, 7th floor, CGO Towers, Kavadiguda, Hyderabad, for information with regard to HFL (Highest Flood Level)
- (2) The Director, Department of Mines & Geology, Govt. of Telangana, II floor, My Home Sarovar Plaza, Adarsh Nagar, Hyderabad-500063.
- (3) The Assistant Director of Mines and Geology, Government of Telangana. Suryapeta.

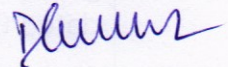

इब्राहिम शरीफ (IBRAHIM SHARIEF)
उप खान नियंत्रक/ Deputy Controller of Mines

मूल प्रति पर नहीं /Not on the Original:

- (1) खान नियंत्रक (द) भारतीय खान ब्यूरो, बंगलूर को प्रतिलिपि सूचनार्थ अग्रेषित ।

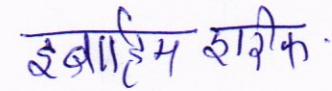

(इब्राहिम शरीफ)
उप खान नियंत्रक